

Date: Thursday, 11/15/2007 1:24:05 PM
 User: Kim Johnston

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: FWD TUBE ASSEMBLY
Job Number	: 35764		
Estimate Number	: 10467		
P.O. Number	:	Part Number	: D3391021
This Issue	: 11/15/2007 S.O. No. :	Drawing Number	: D3391 REV G
Prsht Rev.	: NC	Project Number	: N/A
First Issue	: 1 / Type : MACHINED PARTS	Drawing Revision	: G
Previous Run	: 35763	Material	:
Written By	:	Due Date	: 12/10/2007 Qty: 1 Um: Each
Checked & Approved By	:		
Comment	: Est. A 05.09.13 New issue KJJ/JLM		
	: Est. B 06.02.10 Dwg rev.D ecn 773 EC		
	: Est. C 06.05.02 Added inspections EC		
	: est D 07.03.13 rev F dwg EC		
	: est E 07.11.07 revG dwg ecn1053P EC verified by: DD		
	: Est Rev:f ECN 1056 07-11-12 DD verified by: EC		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	D6013047	SKIDTUBE MAT'L
-----	----------	----------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

SKIDTUBE MAT'L

Pick:

Qty	Part Number	Description
1	D6013-047	Extrusion

Batch

B265 47

DP

2-11-19

2.0	LANDING GEAR 1	LANDING GEAR RESOURCE 1
-----	----------------	-------------------------



Comment: LANDING GEAR RESOURCE 1

Cut extrusion to 46.52 +0.010 -0.020

DP

2-11-19

3.0	BENDING	BENDING MACHINE
-----	---------	-----------------



Comment: Nc bender

Bend as per Dwg D3391 Using Bend Prog 3391021

EL 7-11-26

4.0	QC5	INSPECT WORK TO CURRENT STEP
-----	-----	------------------------------



Comment: INSPECT WORK TO CURRENT STEP

G 7/11/26

5.0	HAAS1	HAAS CNC VERTICAL MACHINING #1
-----	-------	--------------------------------



Comment: HAAS CNC VERTICAL MACHINING #1

1-Machine as per Folio FA590 Rev. F & Dwg D3391 Rev. G

Identify as D3391-1

SA 07.12.04

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 11/15/2007 1:24:05 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 85764

Part Number: D3391021

Job Number:



Seq. #:

Machine Or Operation:

Description:

2-Deburr

6.0

QC2

INSPECT PARTS AS THEY COME OFF MACHINE



Comment: INSPECT PARTS AS THEY COME OFF MACHINE

SA 07.12.04

7.0

MILLING CONV.

CONVENTIONAL MILLING MACHINE



Comment: CONVENTIONAL MILLING MACHINE
Drill X1 Aft cap as per Dwg D3391

SA 07.12.04 (1)

8.0

QC2

INSPECT PARTS AS THEY COME OFF MACHINE



Comment: INSPECT PARTS AS THEY COME OFF MACHINE

SA 07.12.04 (1)

9.0

QC8

SECOND CHECK



Comment: SECOND CHECK

SA 07.12.04 (1)

10.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill float bag holes as per Dwg D3391 using DT8798(Do not open tow cap holes to finish size)
(ONLY DRILL HOLES MARKED "A")

2-Drill Remaining two holes for tow cap using DT 8819 Locating off of .1875" holes drilled in previous step

3-Open tow cap holes to .208" as per Dwg D3391

4-Open Tow Ring hole to .640" as per Dwg D3391

5-Deburr & Scribe Batch number Inside aft end.

DD
7-12-5

DD
7-12-12

11.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08/01/09 (1)

SA 07.12.04

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 11/15/2007 1:24:05 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 35764

Part Number: D3391021

Job Number:



Seq. #:

Machine Or Operation:

Description :

12.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Acid etch and Alodine as per QSI 005 4.1

DP 8-1-9

13.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

BE 08-01-15

14.0

D36704200

SPACER



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

SPACER B35813

batch: M106695

DP 8-1-15

15.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

instal spacers as per dwg D3391

DP 9-5-1

A/R Magnabond 6398

batch: M106695

DP 8-1-15

16.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

DP 08/01/22 (X)

17.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

M107005

DP 08-02-26 (X)

18.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

FZ 08/03/17 (X)

19.0

AELS1032130

INSERT



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

INSERT

batch: M105730

DP 08-03-17 (X)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 11/15/2007 1:24:06 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 35764

Part Number: D3391021

Job Number:



Seq. #:

Machine Or Operation:

Description :

20.0

AELS1032225

INSERT



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

INSERT

batch: M100489

* JH

21.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install Inserts as per Dwg

JH 08-03-17 (X)

22.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

JH 08-03-17 (P)

23.0

D3401041

Tow Cap Assembly



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Tow Cap Assembly

Pick:

Qty

Part Number

Description

Batch

1

D3401-041

Tow Cap

B36126

JH

24.0

D356413

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

B36337

JH

25.0

D356613

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

B32744

JH

26.0

D36721

PHENOLIC WASHER



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

PHENOLIC WASHER

B34470

JH

08-03-17 (X)

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: D Date: 09/03/20
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 11/15/2007 1:24:06 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 35764

Part Number: D3391021

Job Number:



Seq. #:

Machine Or Operation:

Description :

27.0

AN3C4A

BOLT



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

Bolt

Pick:

Qty

Part Number

Description Batch

4

AN3C4A

Bolt

M 107008

yl

28.0

AN960C10L

washer



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

washer

M 107242

yl

29.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: SMALL & MEDIUM FAB RESOURCE 1

Install tow Cap as per Dwg D3391

Identify as D3391-021

yl

08-03-17

(20)

30.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Inspect thread of each insert using DT8821

color/140 (40)

31.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location

35741

8/3/20

50 (12)

32.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

AD 08/03/20

Job Completion



W 08/03/20

Dart Aerospace Ltd


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

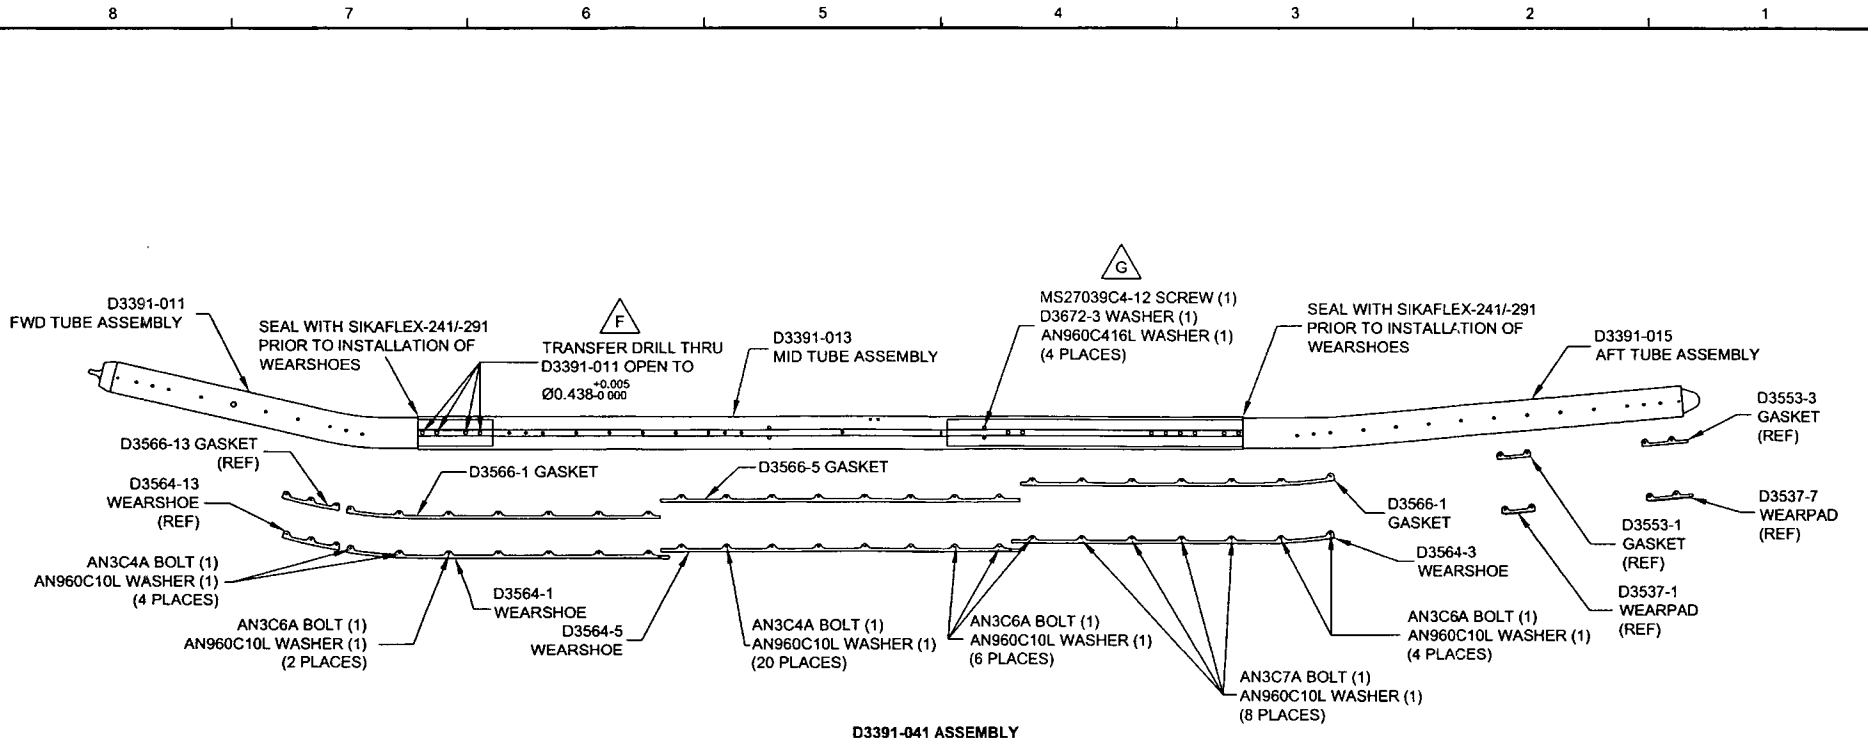

D3391-041 ASSEMBLY

RELEASED
07-11-06

D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
X	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
1	D3566-5	GASKET
4	D3672-3	WASHER
24	AN3C4A	BOLT
12	AN3C6A	BOLT
8	AN3C7A	BOLT
44	AN960C10L	WASHER
4	MS27039C4-12	SCREW
4	AN960C416L	WASHER


GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER. TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 3) UNITS: INCHES UNLESS OTHERWISE NOTED
- 4) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.
- 5)

G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV.	DESCRIPTION	BY	DATE

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	PH	PORT HADLOCK, WA	
CHECKED	PH	DRAWING NO.	REV. G
MFG. APPR.	PH	D3391	SHEET 1 OF 8
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	412 FLOAT SKIDTUBE	NTS
DATE	07.07.31	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	

NO 35764
WORK ORDER
WITHOUT NOTICE
SUBJECT TO AMENDMENT
UNCONTROLLED COPY
RETURN TO
SHOP COPY
ENGINEERING

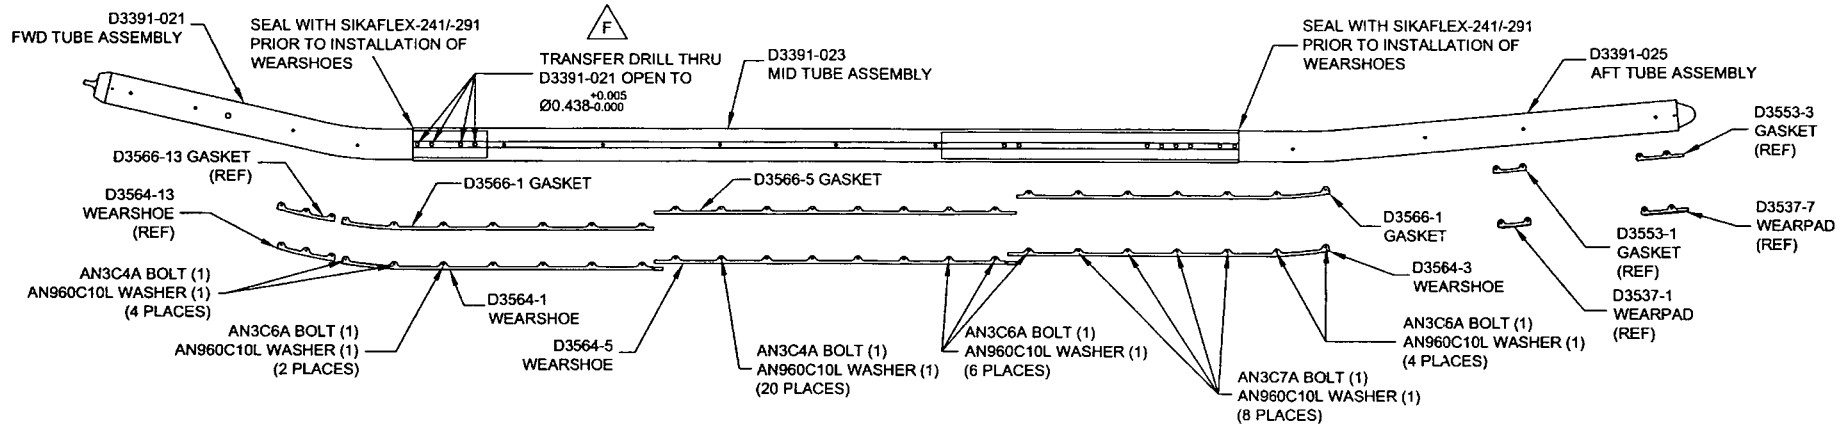

D3391-043 ASSEMBLY

RELEASED
07.11.04

D3391-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST


QTY	PART NUMBER	DESCRIPTION
X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1	D3391-021	FWD TUBE ASSEMBLY
1	D3391-023	MID TUBE ASSEMBLY
1	D3391-025	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
1	D3566-5	GASKET
24	AN3C4A	BOLT
12	AN3C6A	BOLT
6	AN3C7A	BOLT
44	AN960C10L	WASHER

GENERAL NOTES


- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.

DESIGN	PH	DART AEROSPACE USA, INC
DRAWN	JRC	PORT HADLOCK, WA
CHECKED	B	DRAWING NO. REV. G
MFG. APPR.	PH	D3391 SHEET 2 OF 8
APPROVED	PH	TITLE SCALE
DE APPR.	PH	412 FLOAT SKIDTUBE NTS
DATE	07.07.31	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.


NO. 35764
WORK ORDER
SUBJECT TO AMENDMENT
WITHOUT NOTICE
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

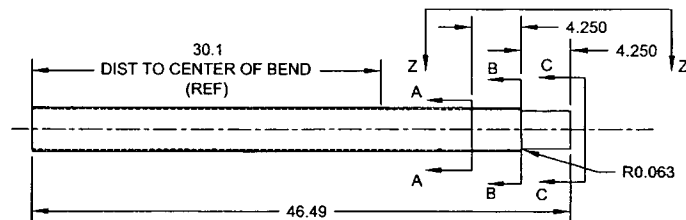


D3391-1 CUTTING DETAIL
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

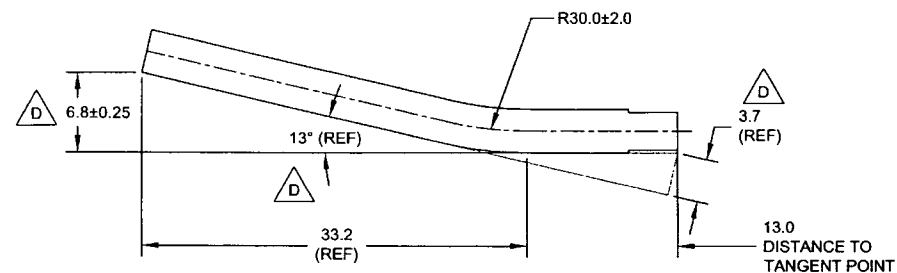


D3391-011/-021 BENDING DETAIL
(MAKE FROM D3391-1)

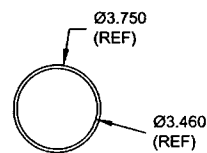


SECTION A-A
(SCALE 1:5)

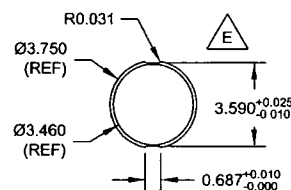

SECTION B-B
(SCALE 1:5)

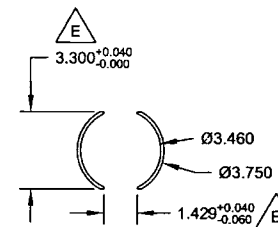

SECTION C-C
(SCALE 1:5)

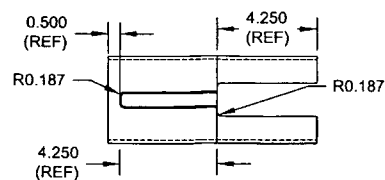











VIEW Z-Z
(SCALE 1:5)

RELEASED
07-11-26 147

NO. 35764
WORK ORDER
WITHOUT NOTICE
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

DESIGN		DART AEROSPACE USA, INC	
DRAWN	BY	PORT HADLOCK, WA	
CHECKED	JC	DRAWING NO. D3391	REV. G
MFG. APPR.		SHEET 3 OF 8	
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	1:10
DATE	07.07.31	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMPILED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

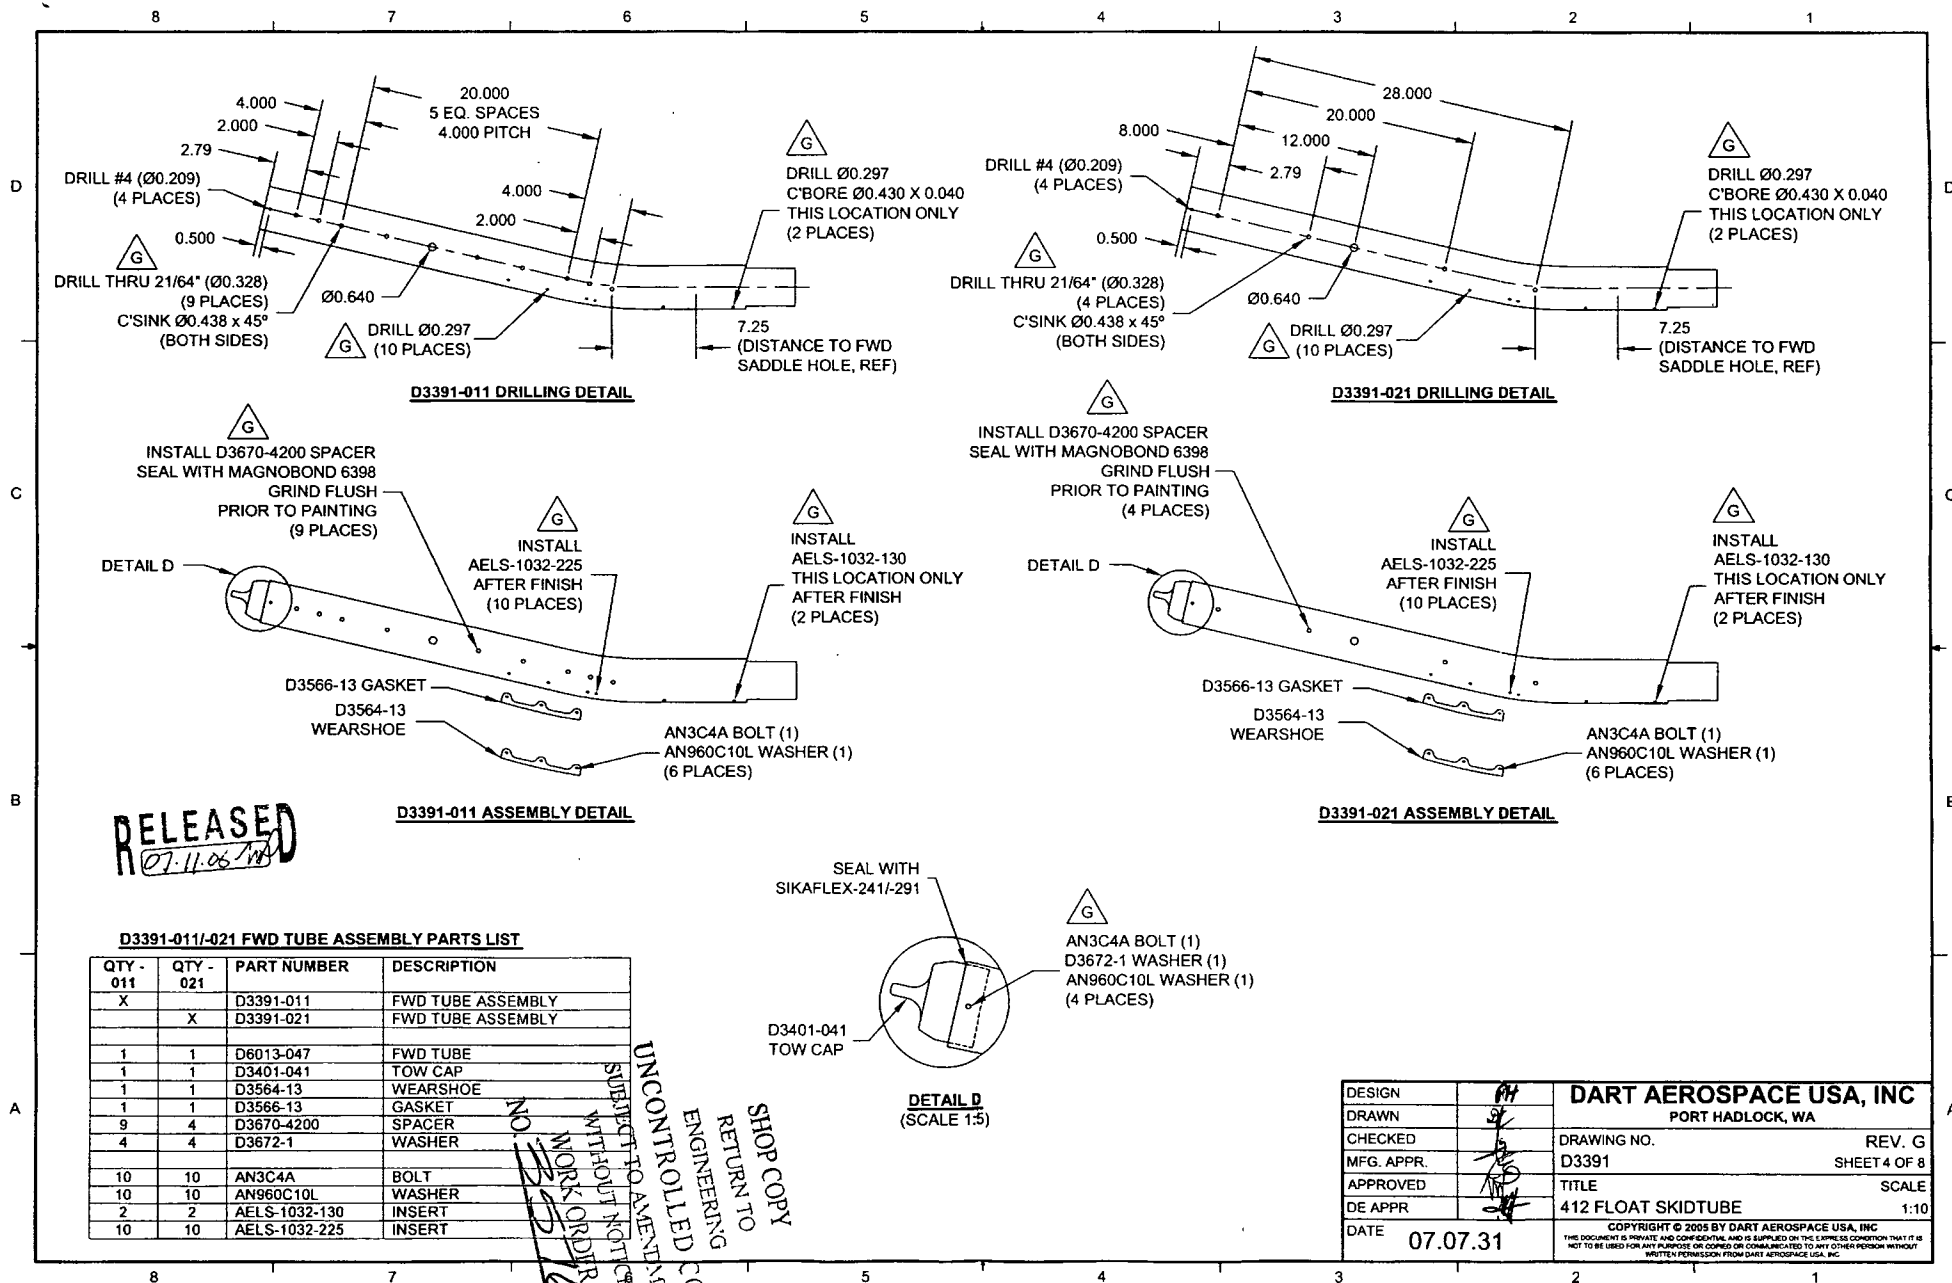

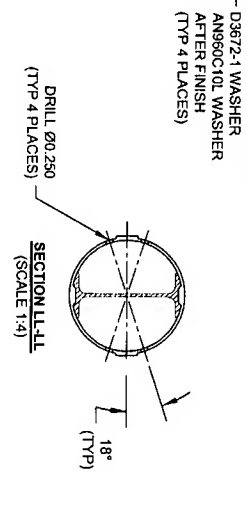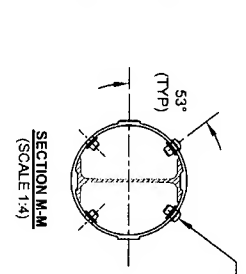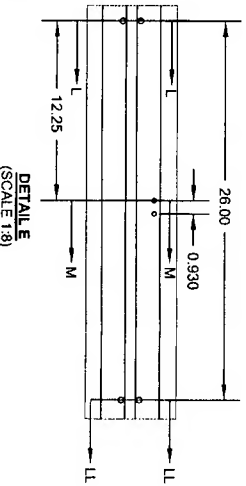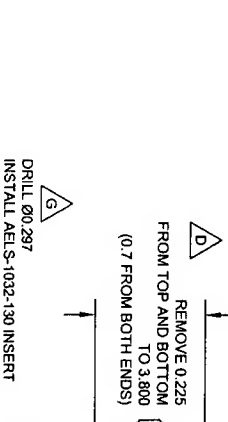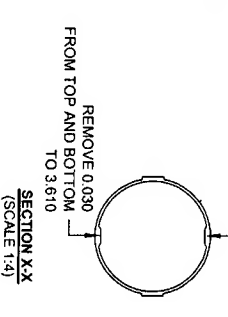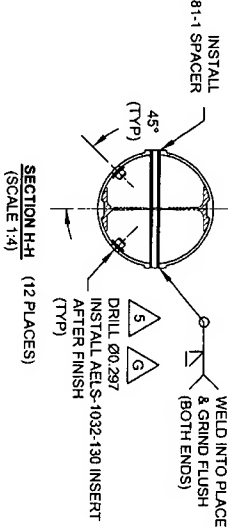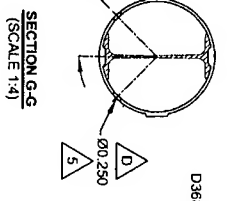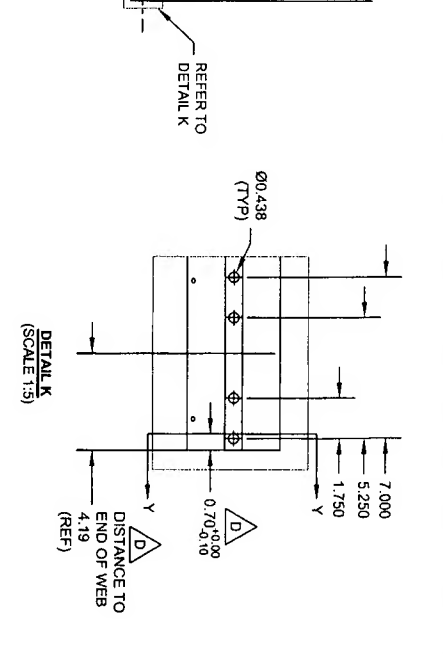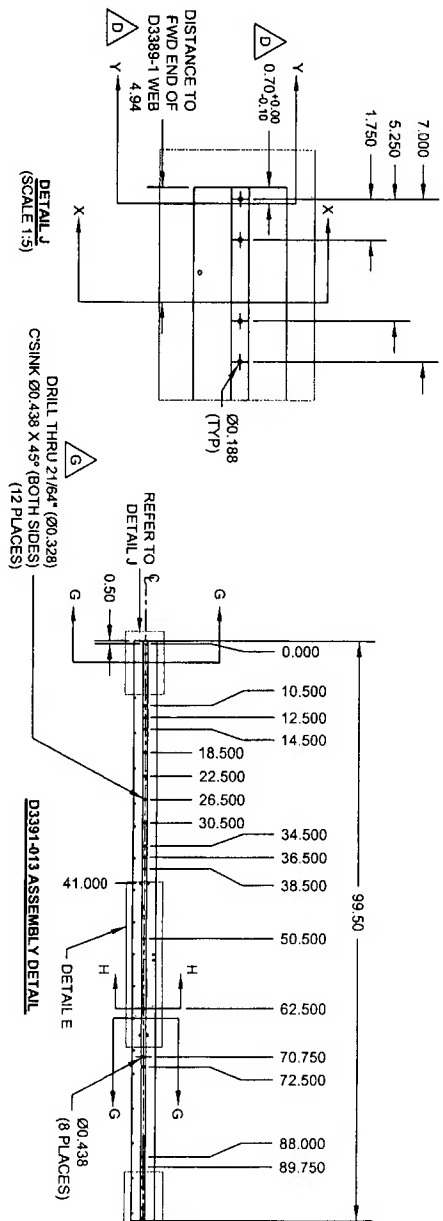

D3391-013 MID TUBE ASSEMBLY PARTS LIST



QTY	PART NUMBER	DESCRIPTION
X	D3391-013	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
12	D3681-1	SPACER
4	D3672-1	WASHER
4	D3672-3	WASHER
24	AELS-1032-130	INSERT
4	ALS4-428-165	INSERT
4	AN960C10L	WASHER
4	AN960C416L	WASHER
4	MS27039C1-08	SCREW
4	MS27039C4-08	SCREW

UNCONTROLLED COPY
RETURN TO
ENGINEERING
SHOP COPY
NO WORK ORDER
SUBJECT TO AMENDMENT
WITHOUT NOTICE

RELEASED
 07.11.2017

DESIGN	TH	DART AEROSPACE USA, INC
DRAWN	SP	PORT HADLOCK, MA
CHECKED	SP	
MFG. APPR.		D3391
APPROVED		
DATE	07.07.31	

412 FLOAT SKIDTUBE
 SCALE 1:20
 SHEET 5 OF 8
 REV. G

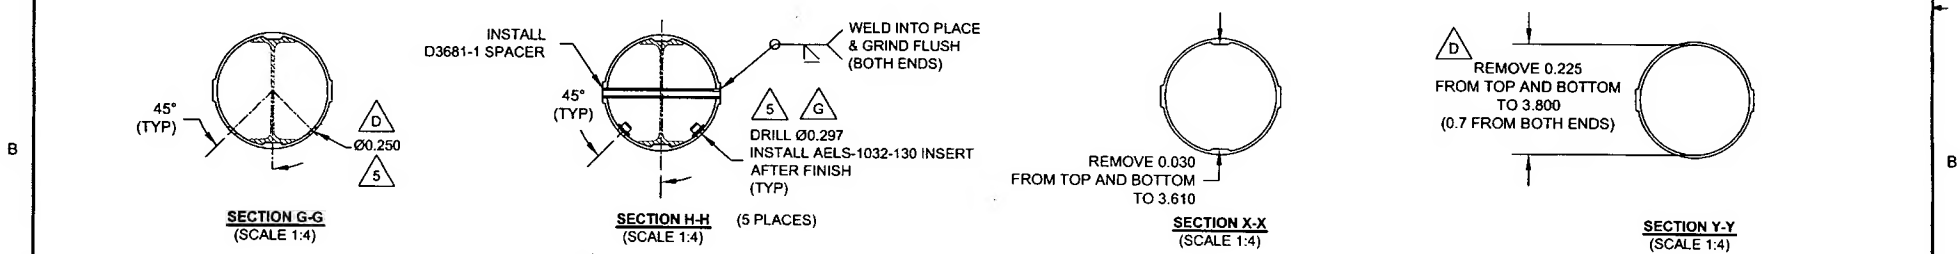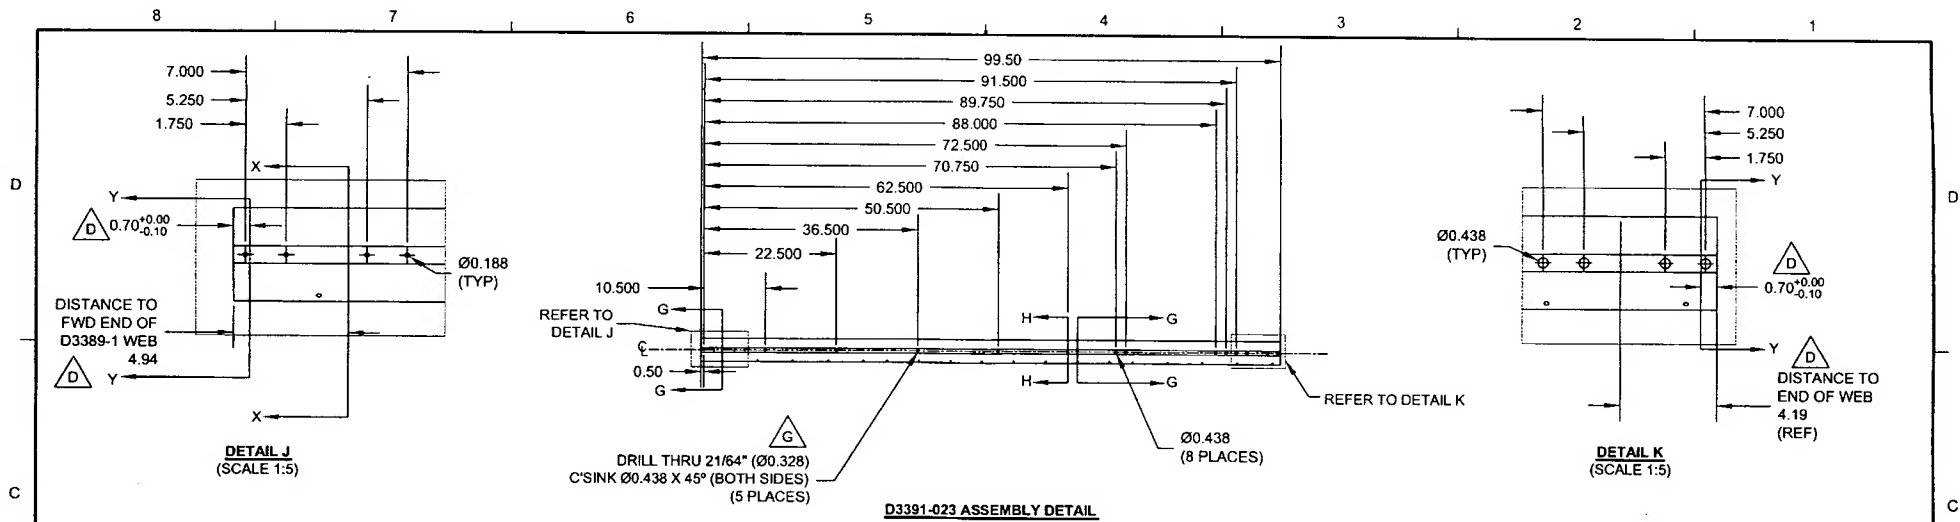

D3391-023 MID TUBE ASSEMBLY PARTS LIST


QTY - 023	PART NUMBER	DESCRIPTION
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT

NO WORK ORDER
 WITHOUT NOTICE
 UNCONTROLLED COPY
 RETURN TO
 SHOP COPY
 ENGINEERING


- D3391-023 MID TUBE ASSEMBLY**
- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
 - 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
 - 3) WELDING: PER DART QSI 004

RELEASED
07.11.06/11

DESIGN	AM	DART AEROSPACE USA, INC	
DRAWN	DE	PORT HADLOCK, WA	
CHECKED	5	DRAWING NO.	REV. G
MFG. APPR.	RD	D3391	SHEET 6 OF 8
APPROVED	5	TITLE	SCALE
DE APPR.	5	412 FLOAT SKIDTUBE	1:20
DATE	07.07.31	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC. <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONVICTION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

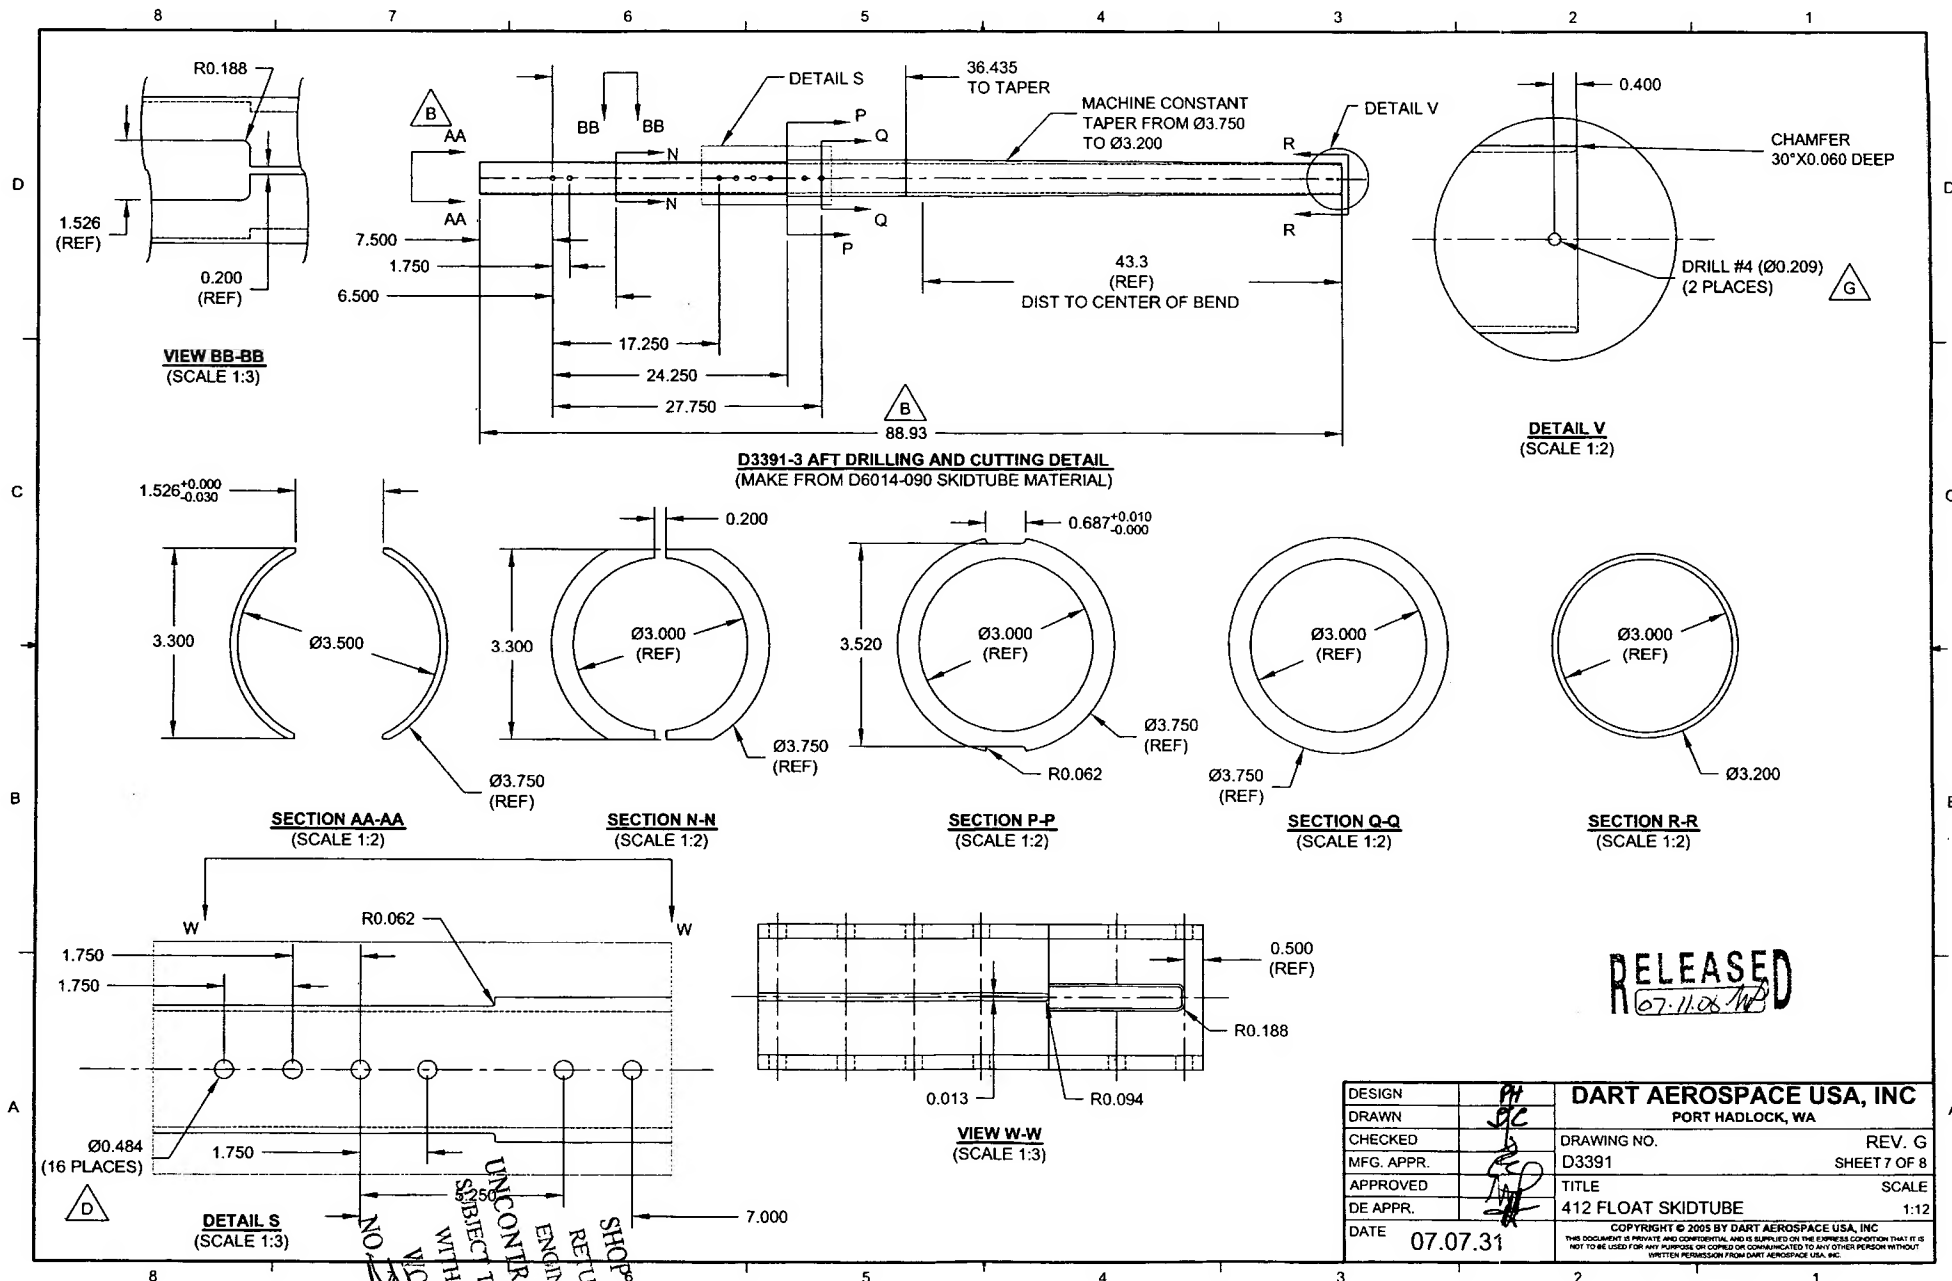

NO. 35764
WORK ORDER
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHO PCOPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE

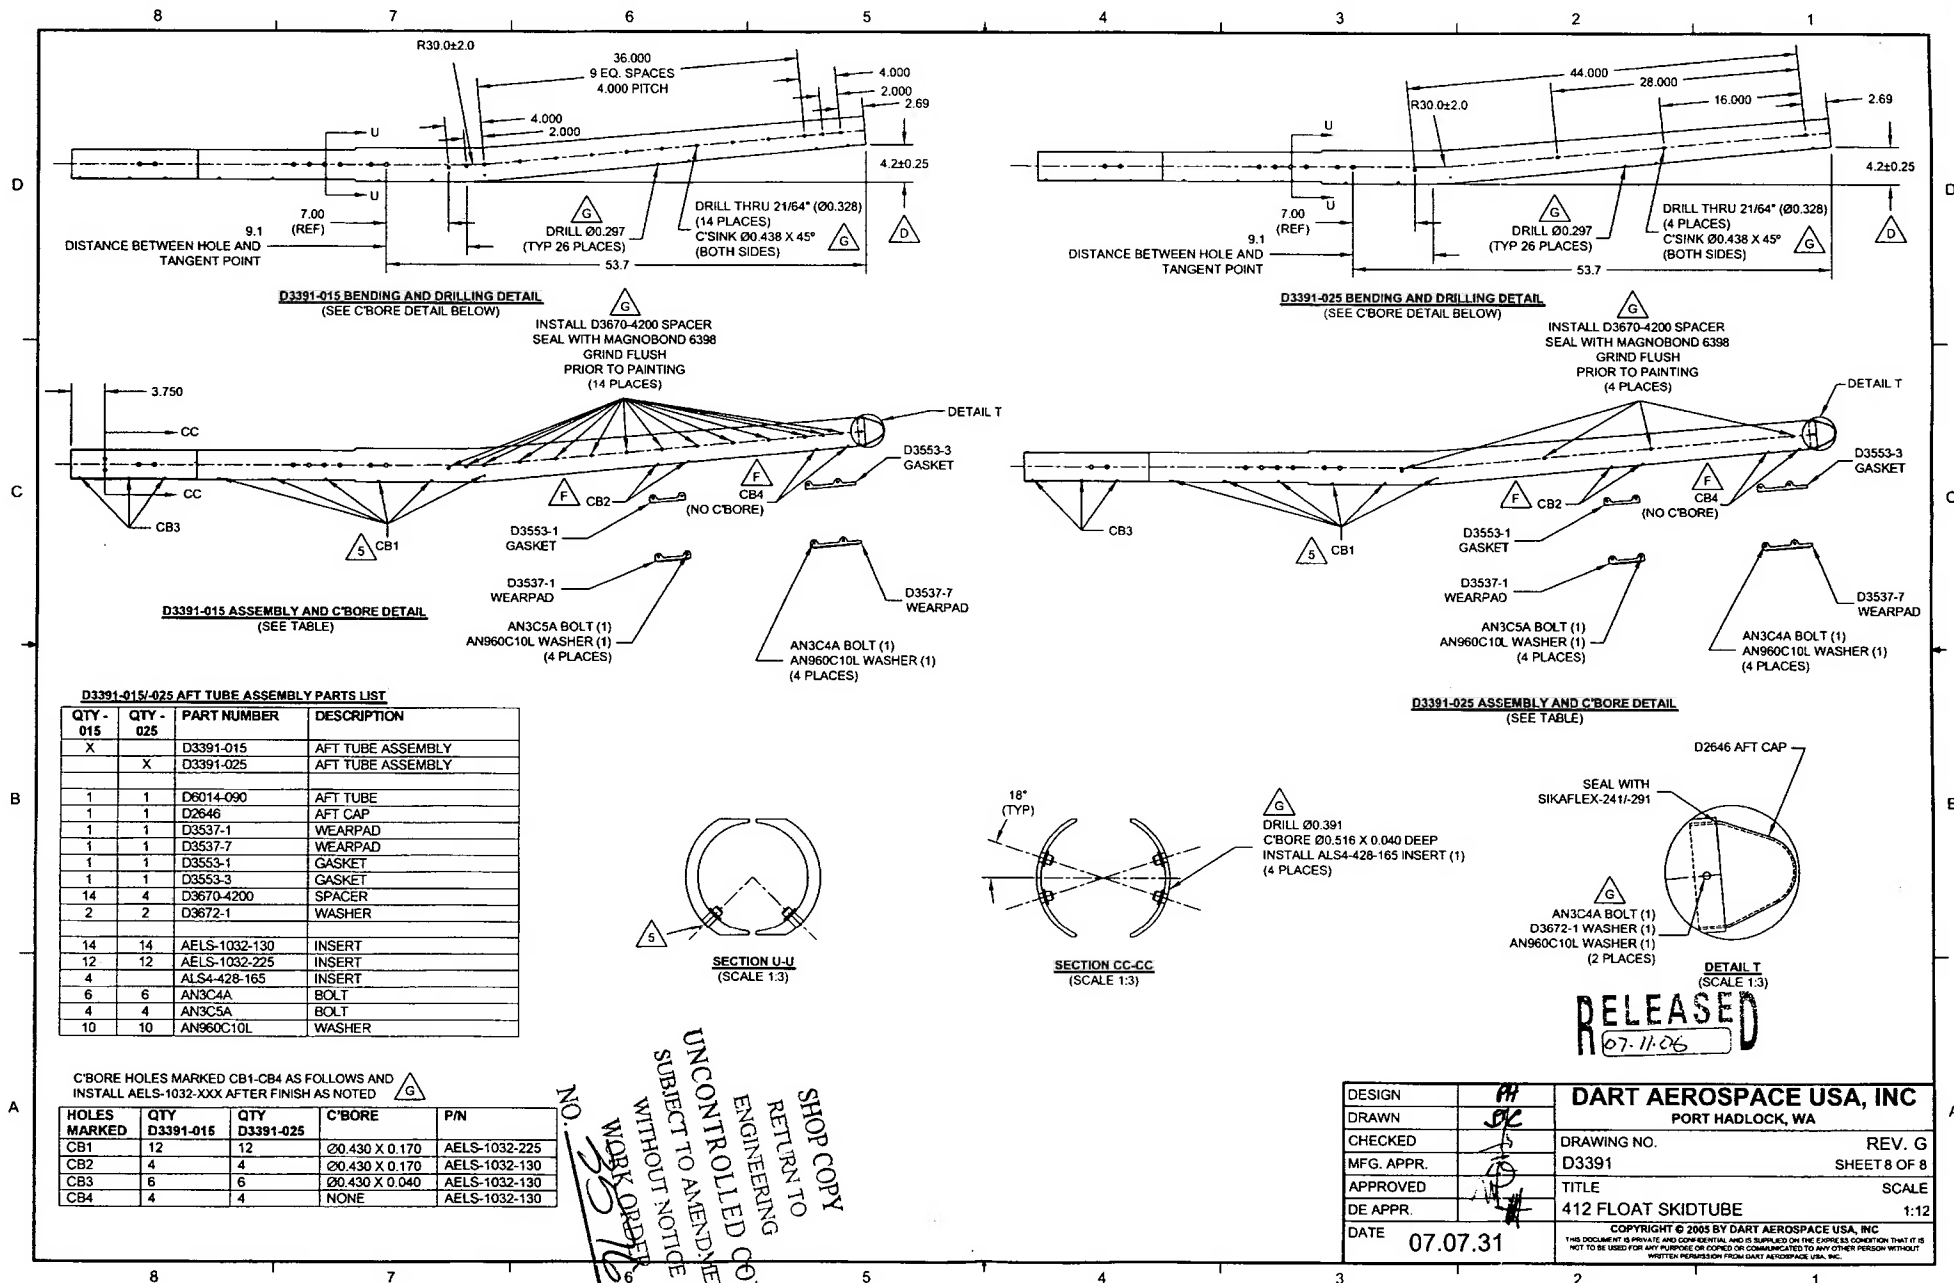

D3391-015/-025 AFT TUBE ASSEMBLY PARTS LIST

QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X	X	D3391-015	AFT TUBE ASSEMBLY
		D3391-025	AFT TUBE ASSEMBLY
1	1	D6014-090	AFT TUBE
1	1	D2646	AFT CAP
1	1	D3537-1	WEARPAD
1	1	D3537-7	WEARPAD
1	1	D3553-1	GASKET
1	1	D3553-3	GASKET
14	4	D3670-4200	SPACER
2	2	D3672-1	WASHER
14	14	AELS-1032-130	INSERT
12	12	AELS-1032-225	INSERT
4	4	ALS4-428-165	INSERT
6	6	AN3C4A	BOLT
4	4	AN3C5A	BOLT
10	10	AN960C10L	WASHER

C'BORE HOLES MARKED CB1-CB4 AS FOLLOWS AND INSTALL AELS-1032-XXX AFTER FINISH AS NOTED

HOLES MARKED	QTY D3391-015	QTY D3391-025	C'BORE	P/N
CB1	12	12	Ø0.430 X 0.170	AELS-1032-225
CB2	4	4	Ø0.430 X 0.170	AELS-1032-130
CB3	6	6	Ø0.430 X 0.040	AELS-1032-130
CB4	4	4	NONE	AELS-1032-130

NO. 35764
WORK ORDER
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	SL	PORT HADLOCK, WA	
CHECKED	SL	DRAWING NO.	REV. G
MFG. APPR.	SL	D3391	SHEET 8 OF 8
APPROVED	SL	TITLE	SCALE
DE APPR.	SL	412 FLOAT SKIDTUBE	1:12
DATE	07.07.31	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			